


363

(Rev. 10-90)
NPS Form 10-900

OMB No. 1024-0018

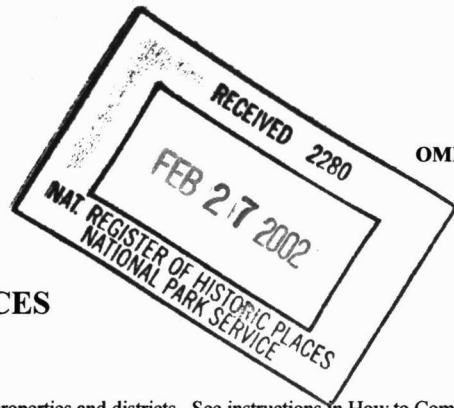

United States Department of the Interior
National Park Service

NATIONAL REGISTER OF HISTORIC PLACES REGISTRATION FORM

This form is for use in nominating or requesting determinations for individual properties and districts. See instructions in How to Complete the National Register of Historic Places Registration Form (National Register Bulletin 16A). Complete each item by marking "x" in the appropriate box or by entering the information requested. If any item does not apply to the property being documented, enter "N/A" for "not applicable." For functions, architectural classification, materials, and areas of significance, enter only categories and subcategories from the instructions. Place additional entries and narrative items on continuation sheets (NPS Form 10-900a). Use a typewriter, word processor, or computer, to complete all items.

1. Name of Property

historic name Mustoe House
other names/site number DHL file # 03-76

2. Location

street & number Route 2, Box 211 (Route 220, near Carlover) not for publication N/A
city or town Hot Springs vicinity X state Virginia
code VA county Bath code 017 Zip 24445

3. State/Federal Agency Certification

As the designated authority under the National Historic Preservation Act of 1986, as amended, I hereby certify that this X nomination request for determination of eligibility meets the documentation standards for registering properties in the National Register of Historic Places and meets the procedural and professional requirements set forth in 36 CFR Part 60. In my opinion, the property X meets does not meet the National Register Criteria. I recommend that this property be considered significant nationally statewide X locally. (See continuation sheet for additional comments.)

[Signature] 2/2/02
Signature of certifying official Date

Virginia Department of Historic Resources
State or Federal agency and bureau

In my opinion, the property meets does not meet the National Register criteria. (See continuation sheet for additional comments.)

Signature of commenting or other official Date

State or Federal agency and bureau

4. National Park Service Certification

I, hereby certify that this property is:
✓ entered in the National Register
 See continuation sheet.
 determined eligible for the
 National Register
 See continuation sheet.
 determined not eligible for the National
 Register
 removed from the National Register
 other (explain): _____

[Signature]
Signature of Keeper
Date of Action 4/12/02

5. Classification

Ownership of Property (Check as many boxes as apply)

- private
- public-local
- public-State
- public-Federal

Category of Property (Check only one box)

- building(s)
- district
- site
- structure
- object

Number of Resources within Property

Contributing	Noncontributing	
<u> 2 </u>	<u> 1 </u>	buildings
<u> </u>	<u> </u>	sites
<u> </u>	<u> </u>	structures
<u> </u>	<u> </u>	objects
<u> 2 </u>	<u> 1 </u>	Total

Number of contributing resources previously listed in the National Register N/A

Name of related multiple property listing (Enter "N/A" if property is not part of a multiple property listing.)
N/A

6. Function or Use

Historic Functions (Enter categories from instructions)

Cat: _____	Sub: _____
<u>Domestic</u>	<u>Single Dwelling</u>
<u>Domestic</u>	<u>Secondary Structure</u>
_____	_____
_____	_____
_____	_____
_____	_____

Current Functions (Enter categories from instructions)

Cat: _____	Sub: _____
<u>Domestic</u>	<u>Single Dwelling</u>
<u>Domestic</u>	<u>Secondary Structure</u>

7. Description

Architectural Classification (Enter categories from instructions)

Other/Log House

Materials (Enter categories from instructions)

Foundation	Stone:	Limestone
Roof	Metal:	Tin
Walls	Wood:	Log
Other	Stone Chimneys	

Narrative Description (Describe the historic and current condition of the property on one or more continuation sheets.)

8. Statement of Significance

Applicable National Register Criteria (Mark "x" in one or more boxes for the criteria qualifying the property for National Register Listing)

- A Property is associated with events that have made a significant contribution to the broad patterns of our history
- B Property is associated with the lives of persons significant in our past.
- C Property embodies the distinctive characteristics of a type, period, or method of construction or represents the work of a master, or possesses high artistic values, or represents a significant and distinguishable entity whose components lack individual distinction.
- D Property has yielded, or is likely to yield information important in prehistory or history.

Criteria Considerations (Mark "X" in all the boxes that apply.)

- A owned by a religious institution or used for religious purposes.
- B removed from its original location.
- C a birthplace or a grave.
- D a cemetery.
- E a reconstructed building, object or structure
- F a commemorative property.
- G less than 50 years of age or achieved significance within the past 50 years.

Areas of Significance (Enter categories from instructions)

Architecture

Period of Significance

ca. 1820-1850

Significant Dates

ca. 1813

ca. 1850

Significant Person (Complete if Criterion B is marked above)

N/A

Cultural Affiliation

N/A

Architect/Builder

Narrative Statement of Significance (Explain the significance of the property on one or more continuation sheets.)

9. Major Bibliographical References

Bibliography

(Cite the books, articles, and other sources used in preparing this form on one or more continuation sheets.)

Previous documentation on file (NPS)

preliminary determination of individual listing (36 CFR 67) has been requested.

previously listed in the National Register

previously determined eligible by the National Register

designated a National Historic Landmark

recorded by Historic American Buildings Survey # _____

recorded by Historic American Engineering Record # _____

Primary Location of Additional Data

State Historic Preservation Office

Other State agency

Federal agency

Local government

University

Other

Name of repository: _____

10. Geographical Data

United States Department of the Interior
National Park Service

National Register of Historic Places
Continuation Sheet

Mustoe House
Bath County, VA

Section 7 Page 1

7. Summary Description:

The Mustoe house is an early-to-mid-nineteenth century log dwelling sited in the middle of open farmland and forested hills in Bath County. The structure was built in three sections that are presently connected. The two-story front section has V-notching and connects to a one-and-a-half-story log hyphen. It, in turn, connects to a separate one-and-a-half-story log structure that has half-dovetail notching. Rear frame additions to the house and a wood frame garage date to the twentieth century. A small log springhouse or meathouse with half-dovetail notching is located near the rear of the structure.

Detailed Description:

The two-story log dwelling stands on the eastern edge of the site, facing the present road and appears to have been constructed in the mid-nineteenth-century. It has V-notching and a gabled, standing-seam metal roof. The main facade has two Greek Revival-style two-panel doors, with an original transom over the left one. To the left of these doors is a six-over-six double-hung window. To the right is a twentieth-century double window, also six-over-six. All of these windows are repeated on the second story. The front facade is about twenty-five feet in length and rises to about seventeen feet at the eave. The squared corners of the V-notching allowed the building to be covered, at one time, with weatherboards that were probably also whitewashed. The weatherboards were removed in the 1980s, and the log walls have since been re-chinked.

There is a large exterior-end limestone chimney on the north gable end of the main building. It consists of coursed rubble and, because of boards added on either side, shows signs of being rebuilt at a smaller size at some point in time. On the first floor there is a six-over-six double-hung window to the right of the chimney, which was probably added at the same time the chimney was rebuilt. The upper gabled ends, clad in flush weatherboards, have a six-pane casement window on each end, visible from inside the attic. While the north one is thought to be original, the south window appears to be a later addition.

United States Department of the Interior
National Park Service

National Register of Historic Places
Continuation Sheet

Mustoe House
Bath County, VA

Section 7 Page 2

Inside, the main dwelling consists of two rooms on the first floor, with a stair in between leading up to a small hall and two rooms above. The northeast room measures about thirteen feet by eighteen feet and contains two large windows on the east wall and a smaller window on the north wall, to the left of a large fireplace. On the west wall are two doors, the northernmost leading out to a porch addition and the southernmost door leading into the log hyphen addition. The front and back doors are both hung with butt hinges but in contrast to the formality of the Greek Revival front doors, the interior doors are plain batten types. The walls are plastered and feature a chair rail, base molding and mid-nineteenth-century rectangular door and window. The massive stone fireplace has a segmental stone arch over the firebox, which has a depth of about eighteen inches. The mantelpiece, also from the mid-nineteenth century, has symmetrical fluted pilasters supporting a bull-nosed shelf. The wood flooring in this room was replaced with tongue-and-groove narrow oak boards sometime in the twentieth century. A cased opening in the south wall separates this room from the next.

The southeast room measures about ten feet by eighteen feet and contains one window and door on the east wall, one on the south wall, and a door leading into the western hyphen addition. This opening contains a batten door with metal strap hinges, and narrow beaded trim. It was probably not added until the hyphen addition was built. The existing stair runs parallel to the interior wall in this room, perpendicular to the main entry. The original stair appears to have been located in the southeast corner, starting its rise parallel to the front facade and turning the corner upward along the south wall. The reconstruction of the ceiling shows visible evidence of an alteration. An extra beam runs perpendicular to the rest of the beams, marking a change in the second-floor boards. There is also a small plugged hole in the first-floor ceiling that was possibly where a newel post was once positioned. The floor replacement in the corner also suggests that the south window was added after the original stairs were removed.

The evolution of these two rooms is not exactly clear. Possibly the first floor was originally built in a typical hall-parlor plan. The remodeling may have included moving the stair to the interior wall and reducing the size of the fireplace in the north room. Whether or not the two front doors are original is also unknown. Possibly one was added

United States Department of the Interior
National Park Service

National Register of Historic Places
Continuation Sheet

Mustoe House
Bath County, VA

Section 7 Page 3

to separate the two spaces into detached living spaces; however both could also be original.

The second floor contains a small hall that runs perpendicular to the top of the stairs. Directly across from the top of the stairs is an opening with a batten door and beaded trim. This leads down three steps into the second floor of the hyphen addition. The northeast room contains closets on the interior wall and double windows on the east wall.

The southeast room contains two six-over-six double-hung windows, one on the east and one on the south. The attic runs the length of the building and is accessible from a trap door in the ceiling. The original thirteen hewn rafters are spaced two feet apart. A series of four-inch wide roof boards spaced about every four inches support the metal roofing. The rafters are pegged at the peak and the existing gable patching seems to suggest original pegged collar ties once existed.

The rear log building stands at the western end of the main house. It is a one-and-one-half story structure with half-dovetail notching and a gabled, standing-seam metal roof. A six-over-six double-hung window is located on the first floor of the south side. The second-floor window on this side is shuttered over and is not visible from the interior. The floor joists from the second story are cut and set into one of the logs, visible on the south elevation. On the second-floor west gable end there is another six-over-six double-hung window set into flush weatherboards that were laid above the eave line.

The interior of the rear building measures about fifteen feet by eleven feet on the first floor. The stone fireplace on the eastern wall has no mantel and an iron cooking crane. A modern toilet and bathtub stand against the west wall. The wide planked oak floor in this room appears to be original, as there is no evidence of floor replacement and it is notched into the stone hearth. It is rare to find such oak flooring in early nineteenth century structures in rural Virginia. An enclosed winding stair with a batten door is located in the northwest corner and leads to a bedchamber above. It has pine flooring and a smaller fireplace. The existing gabled ceiling stands about 7' high. The original use of this building is unclear. It could have been a separate kitchen, or small dwelling or slave quarters. The half-dove tail notching is similar to the meathouse and a small structure across the road from this property. This notching is different from the two-story log

United States Department of the Interior
National Park Service

National Register of Historic Places
Continuation Sheet

Mustoe House
Bath County, VA

Section 7 Page 4

structure with V-notching, indicating that the two sections probably were not constructed at the same time.

In between the original building and the rear building, stands a one-and-a-half-story log hyphen addition. The southern wall has a six-over-six double-hung window on the second floor and a newer double six-over-six double-hung example on the first floor. The second-floor floor joists are cut into a hewn beam on this elevation, in the same method found in the rear building. At the east edge of this ell, there is a vertical post into which the logs are tenoned to provide stability. The western edge of the ell has pegs through the horizontal logs with smaller pieces of wood serving as the tenons between them. On the west side there is a side porch that leads into the existing kitchen on the eastern end and has a storage shed at the western end. Above the porch is a twentieth-century, double-casement, dormer window with a shed roof.

The main room of the hyphen addition has been remodeled to provide a modern kitchen. It contains a door on the north wall, double windows on the south wall and, two cased openings on the east wall that lead into the front rooms. The ceiling rafters are visible and the walls are a combination of plaster and wood paneling. The west wall is covered in wood paneling. The mantel has a beaded surround and beaded supports holding a narrow shelf. To the left of this fireplace is a beaded cased opening leading through a narrow hallway into the rear building.

Upstairs, the main room contains one window on the south wall and the dormer window on the north. On the west wall, the placement of the chimney is evident from its projection into the room. On the left side of the chimney is a beaded cased opening with a batten door that leads through a small hall into the upstairs of the rear building. This wall with the cased opening is constructed of vertical wood planking. The eastern wall is made of log construction with plaster chinking visible between the logs. This wall contains three steps up to the hallway opening of the main building.

To the west of the rear building is a one-story, board-and-batten addition clad with bricktex underneath the siding. It has a six-over-six double-hung window on the south elevation and a shed standing-seam metal roof. Adjoining this addition is a 1940's

United States Department of the Interior
National Park Service

National Register of Historic Places
Continuation Sheet

Mustoe House
Bath County, VA

Section 7 Page 5

rectilinear wing with weatherboard siding that extends north-south. A small square room is attached to the rear of this wing. It has one single-paned, double-hung window on both the north and south elevations and a double window of the same type on the west elevation. The west elevation of the long wing has one six-over-six double-hung window and one set of eight-paned triple casement windows. The east elevation has both sets of these windows and a single-pane three-panel door. The wing has a gable metal roof with a centrally located brick flue and a small attached porch. Inside, this rear apartment wing contains four rooms with French type, glass-paned doors, pine floors and plain board molding.

Another small log building, possibly used as a springhouse or a meathouse, stands to the south of the log house. It is rectangular in shape and has half-dovetail notching and a standing-seam metal roof. Its batten door has strap hinges. While not on the same property, another vacant log structure stands across the road to the east of the site. It also has half-dovetail notching and still contains the original fireplace as well as the staircase and shed wings. It is possible this was used as the Mustoe early log home while the first was being built or was part of their original property.

The newest building on the site is a two story L-shaped barn with a copper-clad gambrel roof. Completed in 2000, this noncontributing frame structure is situated at the northwest corner of the site, with the long end of the building running east-west. It has four garage doors on the south and east walls and two dormers on the south wall. One of these dormers has a pair of French doors with sidelights and a balcony. The first floor is used as a display space for the antique store currently in the main building while the second floor contains an L-shaped apartment.

United States Department of the Interior
National Park Service

National Register of Historic Places
Continuation Sheet

Mustoe House
Bath County, VA

Section 8 Page 1

8. Statement of Significance

The Anthony Mustoe house represents a typical rural dwelling of the early to mid-nineteenth century in Bath County. The log construction is one of only a few surviving examples of what was once the most common type of building material in this area of western Virginia during a time period when land needed to be cleared and homesteaded. The evolution of the house clearly reflects the changing needs and growth of the Mustoe family who owned the property from 1813 to 1942. This property embodies the distinctive characteristics of a type, period, or method of construction (Criteria C).

Historical Background

The area of Falling Spring Valley was settled by family patriarch, Anthony Mustoe I, in October 1792. Mustoe, the first of four generations of Anthony Mustoes to live in the area, was born in England in 1748. He immigrated to America and served in the 3rd, 5th, 7th and 12th Virginia Regiments of the Continental Army and he joined George Washington's army at Valley Forge on Feb. 28, 1777.¹ He first appears in the local records of Augusta County in May 1784 when he is listed as a captain in a company of patrollers. He also was deputy sheriff of the county from 1785 to 1788.² Mustoe had numerous tracts of land in Bath County totalling over 10,000 acres and by the time of his death in 1807, the name of Mustoe had been indelibly etched in the annals of Bath County history.

He and his wife had six children, one of whom was Anthony Mustoe, Jr. (II), born in 1784. Anthony Mustoe, Jr. (II) married Anna Nancy Givens on January 3, 1803 and established a residence in Falling Spring Valley on the tract of land on which the Mustoe house stands today. A January 31, 1804 document in Bath County is a record of Anthony Mustoe I giving a variety of personal property to Anthony Mustoe II "who recently married Anna Givens." Among the items given by the father to his eldest son and namesake were "a still, a feather bed," other furniture and livestock.³ Where the newlyweds set up housekeeping is a question open to debate, but there is strong evidence that Anthony Mustoe II soon began to build the log structure on land that is the subject of this report. It should be noted that Mustoe did not own the property in question in

United States Department of the Interior
National Park Service

National Register of Historic Places
Continuation Sheet

Mustoe House
Bath County, VA

Section 8 Page 2

1803 or 1804 when he took up housekeeping. The actual purchase of the property by Mustoe II from John and Rachel Lewis did not take place until a decade later, in November 1813, but the wording of that deed makes it perfectly clear that the Mustoes were already in residence at the time of purchase. The 300-acre tract was described in the deed as land "on which the said Anthony Mustoe now lives."⁴

Probably sometime between his 1803 marriage and his 1813 acquisition of the land, Anthony and Anna Mustoe, rented the farm and later built a house on the property. Family tradition states that the back portion of the current log house may have been the original house on the property; however, it may have been the kitchen, a slave quarters or another outbuilding to the property.⁵

Anthony Mustoe II's profession is not known although his estate inventory indicates that he farmed and owned blacksmith's tools.⁶ Certainly his son, Anthony Mustoe III, was a blacksmith (listed in the census) and owned a set of blacksmith tools that he purchased at his father's December 28, 1861 estate sale for \$10.⁷ Blacksmith tools then show up in his own 1881 estate inventory where they were purchased by his son, George, for \$5.⁸ By the second half of the nineteenth century, Anthony Mustoe III "had a little blacksmith's shop on the opposite side of the road where he did all the iron work that the farm needed."⁹

Also, by the mid-nineteenth century the Mustoes had prospered enough on the farm that they apparently built a two-story log house that still serves as the main house on the property. The third Anthony Mustoe listed in the Bath County records, Anthony Mustoe III, was born in 1821 and lived on the property in question all of his life. He died intestate in 1881. He is the man who was listed in the census as a blacksmith and certainly ran a very successful farm in the valley. His neighbors referred to him as Squire Mustoe, a title often placed upon men of the landed gentry.¹⁰

Two changes in the land tax records indicate periods in which improvements might have been made to the house and its outbuildings. The first jump in value occurs in 1840 when the assessment on the buildings goes from \$168.75 to \$200. The second rise occurs in

United States Department of the Interior
National Park Service

National Register of Historic Places
Continuation Sheet

Mustoe House
Bath County, VA

Section 8 Page 3

1851 when the value of the buildings moves from \$200 to \$300.¹¹ It is very possible that this second jump marks the point at which the two-story log house with V notching was built. The logs were weatherboarded over and painted or whitewashed to remain consistent with the rising prosperity of the Mustoe family and the logs remained covered until the late twentieth century.

The Mustoe family's fortunes continued to rise throughout the nineteenth century. Not only did the farm prosper, but related agrarian trades such as blacksmithing, milling, spinning, and weaving took place as well.¹² The Mustoes were referred to as "first-class farmers in our mountains," who had "health, education, refinement, courtesy, piety, and leadership." Their wealth was such that for some time they were the only family in the valley to own a buggy.¹³

Successive generations raised in the house continued in prominence, serving in the Civil War, World War I, and World War II. Colonel Anthony Q. Mustoe served valiantly in the Air Force in World War II, becoming Commanding Officer of the Eighth Army Air Force Bomber Station. Robert L. Mustoe, the son of Anthony Mustoe III, served as the Bath County treasurer in the early twentieth century.¹⁴

The last member of the Mustoe family to reside on the farm was Bess Mustoe Tucker. In 1942 the farm passed out of the family's hands when it was sold to W.J. Lowry. The widow Annie A. Lowry sold the land to Louis and Clara Dufour in 1968 who then conveyed it to Rene Raymond Dufour in 1971. In 1992 the land was sold to Todd R. and Mary-Clair Briggs who, in turn, sold the house and approximately one acre of land to the Alexanders, the current owners.¹⁵

United States Department of the Interior
National Park Service

National Register of Historic Places
Continuation Sheet

Mustoe House
Bath County, VA

Section 8 Page 4

ENDNOTES:

- ¹ Dr. James Mustoe, Gay and Mustoe family web page, www.ezl.com/~pfrazier/mustoe.txt
- ² Augusta County records, courthouse, Staunton, VA
- ³ Bath County deed book 2:586
- ⁴ Augusta County records, courthouse, Staunton, VA
- ⁵ Christy M. Szczesny report, University of Virginia Architectural History program, 1999
- ⁶ Bath County will book 6:22-23.
- ⁷ Bath County will book 6:377; census material at the Bath County Historical Society in Warm Springs, VA
- ⁸ Bath County bill book 7:131-133.
- ⁹ Untitled publication, dated 11 January 1923 and referring to the 1870s.
- ¹⁰ Dr. James Mustoe, web page: Mustoe file at the Bath County Historical Society; Untitled publication; Bath County will books.
- ¹¹ Bath County land tax records.
- ¹² Untitled publication and Mustoe estate inventories found in Bath County will books.
- ¹³ Untitled publication.
- ¹⁴ "Mustoe biographical sketch," found in *The American Historical Society*, photocopy of the page found in the Mustoe file at the Bath County Historical Society.
- ¹⁵ Bath County deed books and "The Mustoe House" report by Todd and Mary Claire Briggs.

**United States Department of the Interior
National Park Service**

**National Register of Historic Places
Continuation Sheet**

**Mustoe House
Bath County, VA**

Section 9 Page 1

BIBLIOGRAPHY

Augusta County Courthouse Records. Chancery court records, court order books, deed books, land tax books, will books. Augusta County Courthouse, Staunton, Va.

Bath County Courthouse Records. Deed books, land tax books, survey books, will books, Bath County Courthouse, Warm Springs, Va.

Briggs, Todd and Mary Claire, "The Mustoe House," report written by owners of Mustoe house, date unknown.

McCleary, Dr. Ann. Telephone interview with architectural historian Ann McCleary concerning vernacular architectural styles in western Virginia and log notching types. Interview conducted by Nancy Sorrells. June 2000.

Moreton, Oren F. *The Annals of Bath County, Virginia* (Bridgewater, Va.: C.J. Carrier Co., 1970, reprint of 1917 edition).

"Mustoe," biographical sketch from *The American Historical Society*. Photocopy found in Mustoe family file, Bath County Historical Society, Warm Springs, Va.

Mustoe family file, Bath County Historical Society, Warm Springs, Va.

**United States Department of the Interior
National Park Service**

**National Register of Historic Places
Continuation Sheet**

**Mustoe House
Bath County, VA**

Section 9 Page 2

Mustoe, Dr. James L., "Gay and Mustoe family web page" available at

www.ezl.com/~pfrazier/mustoe.txt.

Szczesny, Christy M., "A Log House in the Virginia Valley," Architectural History report by

University of Virginia student, December 1999.

**United States Department of the Interior
National Park Service**

**National Register of Historic Places
Continuation Sheet**

**Mustoe House
Bath County, VA**

Section 10 Page 1

Verbal Boundary Description

The boundaries of the nominated property coincide with the plat map seen in Tax Ref. 101-15 found in Bath County Courthouse Clerk's office.

Boundary Justification

The boundary includes the existing one acre lot described on the attached sketch map. It includes the previously referred to contributing and non-contributing buildings. The lot was originally larger in the nineteenth century but pieces of land have since then been sold and today these parcels remain in other ownership.

Acreage of Property 1.0 acre

UTM References (Place additional UTM references on a continuation sheet)

	<u>Zone</u>	<u>Easting</u>	<u>Northing</u>		<u>Zone</u>	<u>Easting</u>	<u>Northing</u>
1	<u>17</u>	<u>597480</u>	<u>4197450</u>	2	<u> </u>	<u> </u>	<u> </u>
3	<u> </u>	<u> </u>	<u> </u>	4	<u> </u>	<u> </u>	<u> </u>

 See continuation sheet.

Verbal Boundary Description (Describe the boundaries of the property on a continuation sheet.)

Boundary Justification (Explain why the boundaries were selected on a continuation sheet.)

11. Form Prepared By

name/title: Cleary Larkin

Organization: Frazier Associates date 5-9-01

street & number: 213 North Augusta Street telephone 540-886-6230

city or town Staunton state VA zip code 24401

Additional Documentation

Submit the following items with the completed form:

Continuation Sheets

Maps

- A USGS map (7.5 or 15 minute series) indicating the property's location.
- A sketch map for historic districts and properties having large acreage or numerous resources.

Photographs

Representative black and white photographs of the property.

Additional items (Check with the SHPO or FPO for any additional items)

Property Owner

(Complete this item at the request of the SHPO or FPO.)

name Dr. Wayne Alexander

street & number 3701 West End, No. 9 telephone 615-383-8484

city or town Nashville state TN zip code 37205

**United States Department of the Interior
National Park Service**

**National Register of Historic Places
Continuation Sheet**

**Mustoe House
Bath County, VA**

Section Photographs Page 1

All photographs are of:

MUSTOE HOUSE
Bath County, VA
DHL FILE # 03-76
NEG. NO.: 18685, 19365
CREDIT: Cleary Larkin
DATE: 2000

NEGATIVE FILED: Va. Dept. of Historic Resources, Richmond, VA

1. VIEW OF: east elevation-main building; view looking west
PHOTO 1 of 10

2. VIEW OF: front of twentieth-century addition; view looking southwest
PHOTO 2 of 10

3. VIEW OF: north elevation of log hyphen addition and main dwelling; view looking southwest
PHOTO 3 of 10

4. VIEW OF: log outbuilding; view looking southwest
PHOTO 4 of 10

5. VIEW OF: southeast corner of main dwelling; view looking northwest
PHOTO 5 of 10

6. VIEW OF: interior of front door and transom, first floor
PHOTO 6 of 10

**United States Department of the Interior
National Park Service**

**National Register of Historic Places
Continuation Sheet**

**Mustoe House
Bath County, VA**

Section Photographs Page 2

7. VIEW OF: interior of hyphen addition, second floor looking east
PHOTO 7 of 10

8. VIEW OF: interior of hyphen addition, second floor looking west
PHOTO 8 of 10

9. VIEW OF: attic rafters
PHOTO 9 of 10

10. VIEW OF: paneled kitchen wall, first floor looking west
PHOTO 10 of 10

**United States Department of the Interior
National Park Service**

**National Register of Historic Places
Continuation Sheet**

**Mustoe House
Bath County, VA**

Section Negatives Page 1

Roll 18685


Frame # Description

- 0 southeast corner of main dwelling; view looking northwest
- 4 log outbuilding; view looking southwest
- 8 paneled kitchen wall, first floor looking west
- 21 front of twentieth century addition; view looking southwest
- 22 north elevation of log hyphen addition and main dwelling; view looking southwest

Roll 19365

Frame # Description

- 0 attic rafters
- 2 interior of log hyphen addition, second floor looking west
- 7 interior of log hyphen addition, second floor looking east
- 14 interior of front door and transom, first floor
- 24 east elevation-main building; view looking west

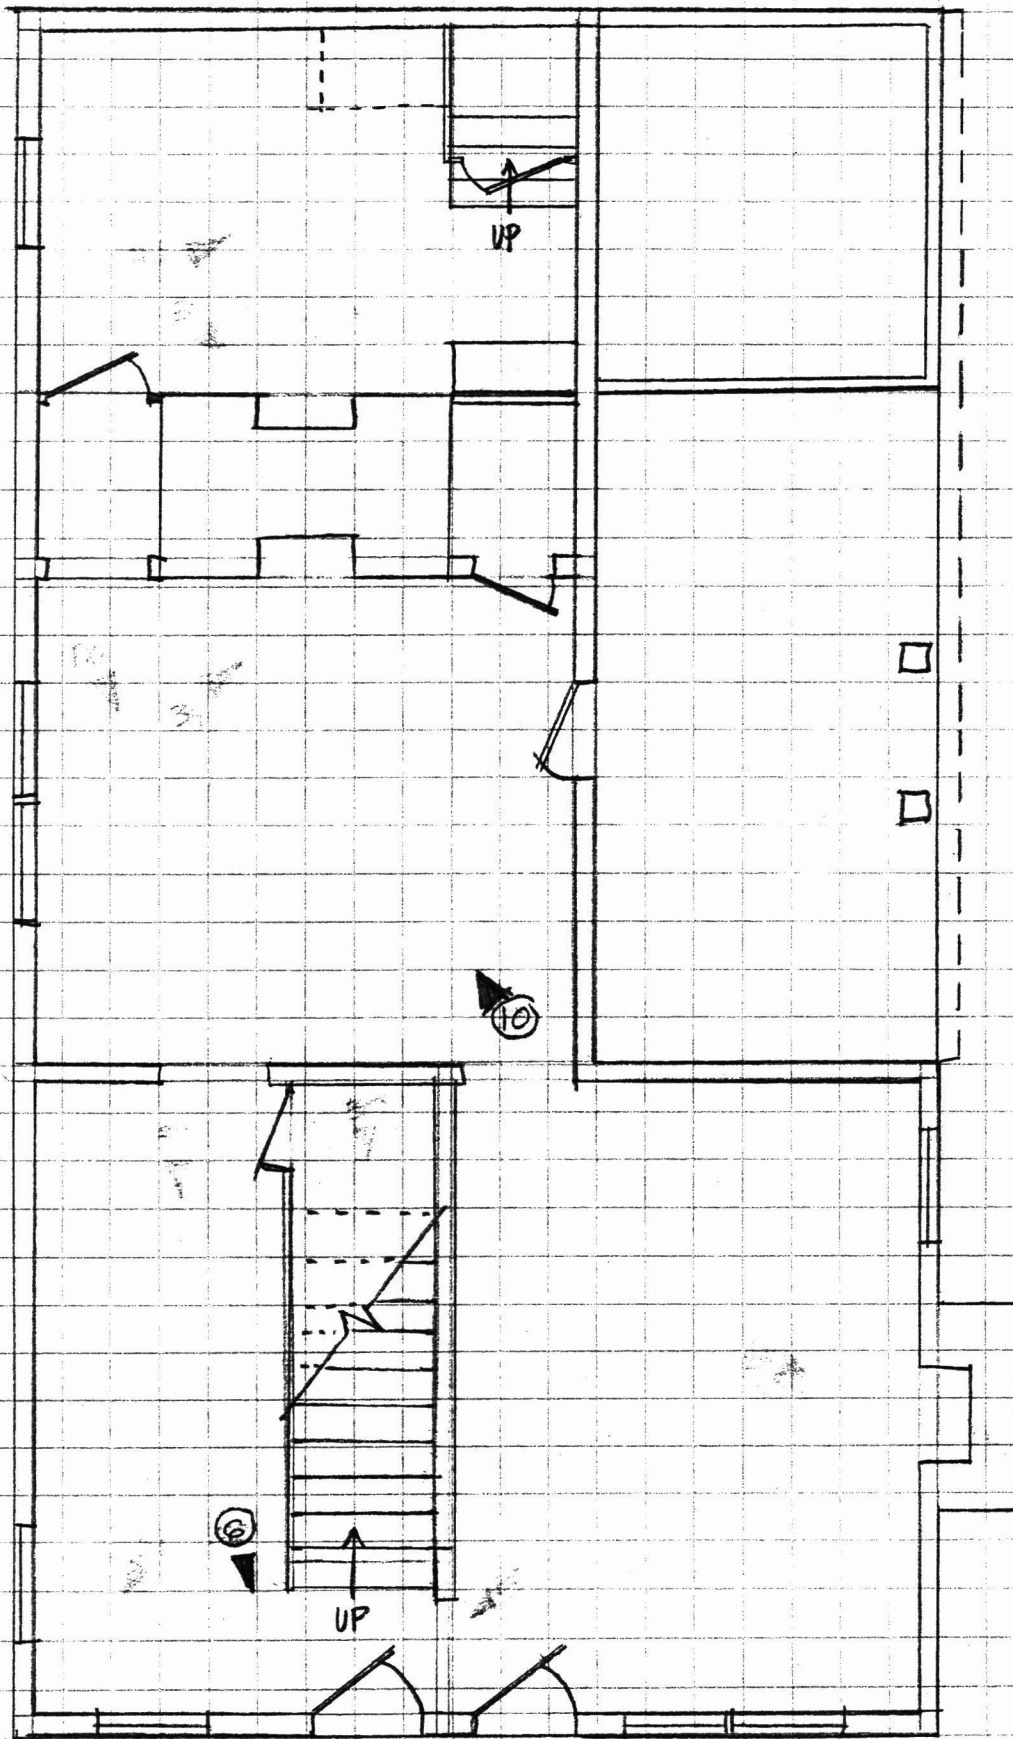


FILE 03-76
MUSTOE HOUSE
BATH COUNTY, VA

1ST FLOOR
EXISTING PLAN

$\frac{3}{16}'' = 1'-0''$



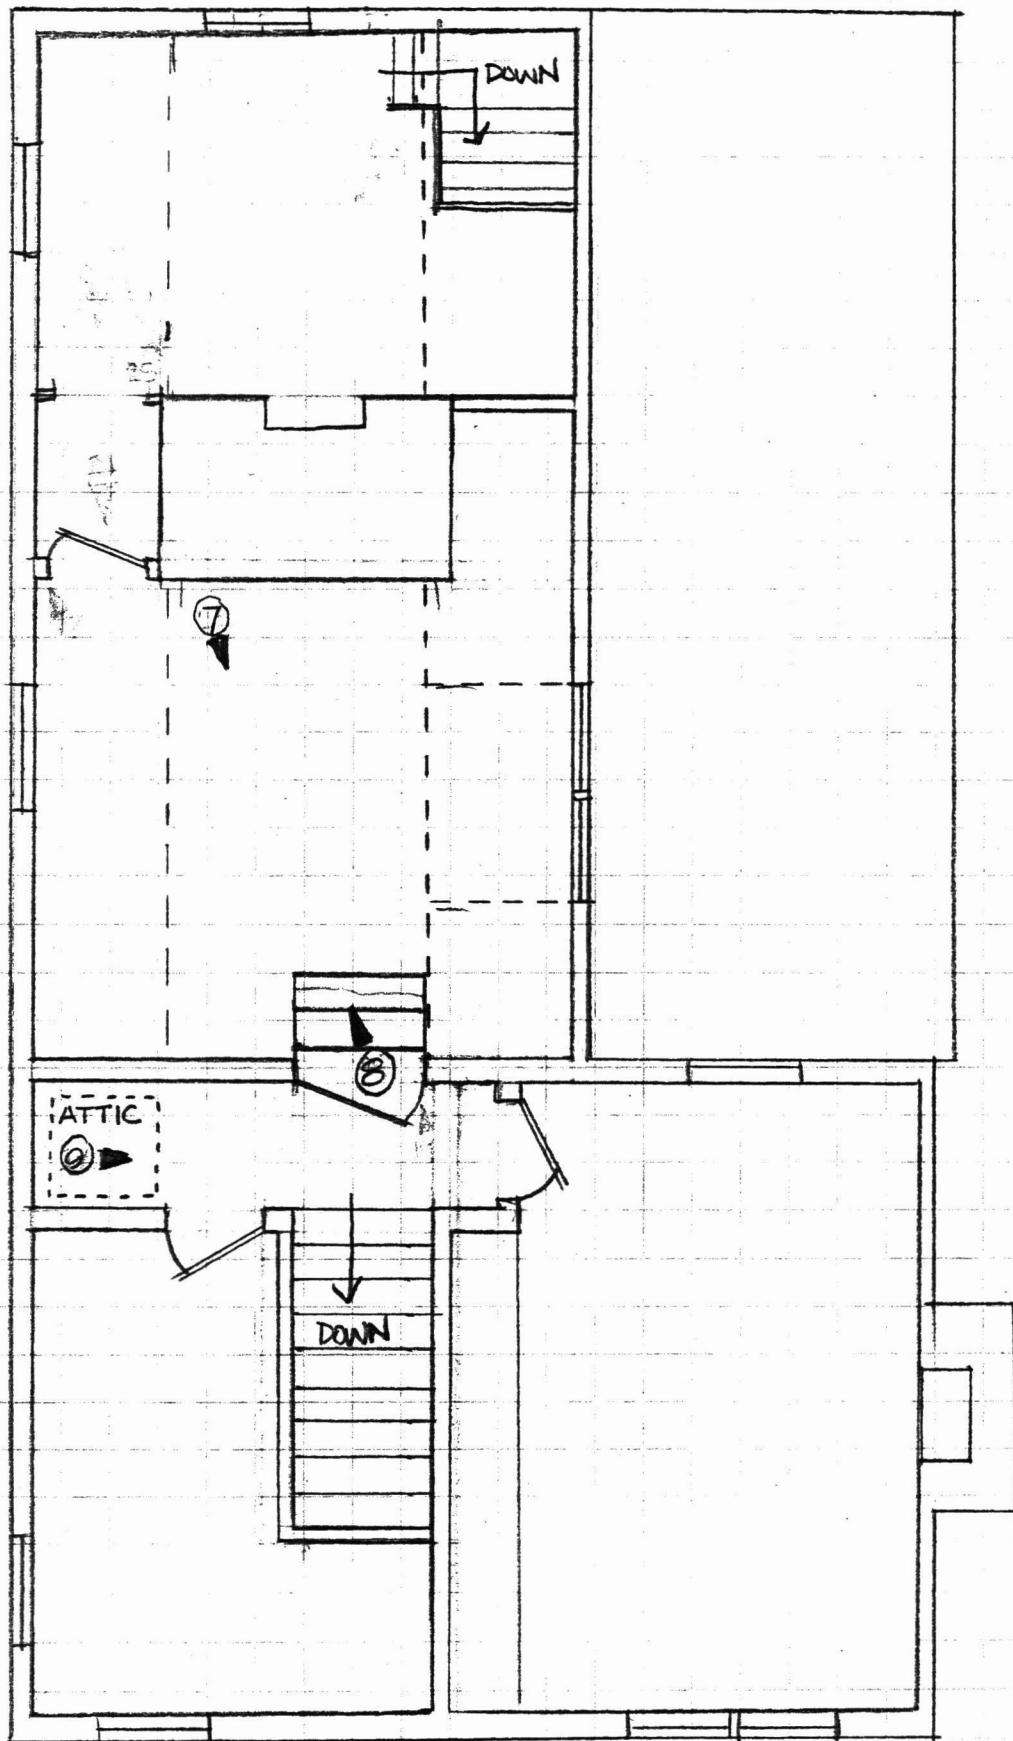

FILE 03-76
MUSTOE HOUSE
BATH COUNTY, VA

2ND FLOOR
EXISTING PLAN

$\frac{3}{16}'' = 1'-0''$



UNITED STATES DEPARTMENT OF THE INTERIOR
NATIONAL PARK SERVICE

NATIONAL REGISTER OF HISTORIC PLACES
EVALUATION/RETURN SHEET

REQUESTED ACTION: NOMINATION

PROPERTY NAME: Mustoe House

MULTIPLE NAME:

STATE & COUNTY: VIRGINIA, Bath

DATE RECEIVED: 2/27/02 DATE OF PENDING LIST: 3/26/02
DATE OF 16TH DAY: 4/11/02 DATE OF 45TH DAY: 4/13/02
DATE OF WEEKLY LIST:

REFERENCE NUMBER: 02000363

REASONS FOR REVIEW:

APPEAL: N DATA PROBLEM: N LANDSCAPE: N LESS THAN 50 YEARS: N
OTHER: N PDIL: N PERIOD: N PROGRAM UNAPPROVED: N
REQUEST: N SAMPLE: N SLR DRAFT: N NATIONAL: N

COMMENT WAIVER: N

ACCEPT RETURN REJECT 4.12.02 DATE

ABSTRACT/SUMMARY COMMENTS:

**Entered in the
National Register**

RECOM./CRITERIA _____

REVIEWER _____ DISCIPLINE _____

TELEPHONE _____ DATE _____

DOCUMENTATION see attached comments Y/N see attached SLR Y/N



1 OF 10

MUSTOE HOUSE
BATH COUNTY VA



2 OF 10

MUSTOE HOUSE
BATH COUNTY VA



3 OF 10

MUSTOE HOUSE
BATH COUNTY VA



↑ OF 10

MUSTOE HOUSE
BATH COUNTY VA



5 OF 10

MUSTOE HOUSE
BATH COUNTY VA



6 OF 10

MUSTOE HOUSE
BATH COUNTY VA



7 OF 10

MUSTOE HOUSE
BATH COUNTY VA



8 OF 10

MUSTOE HOUSE
BATH COUNTY VA




9 OF 10

MUSTOE HOUSE
BATH COUNTY VA





10 of 10

Mustoe House
Bath County, VA

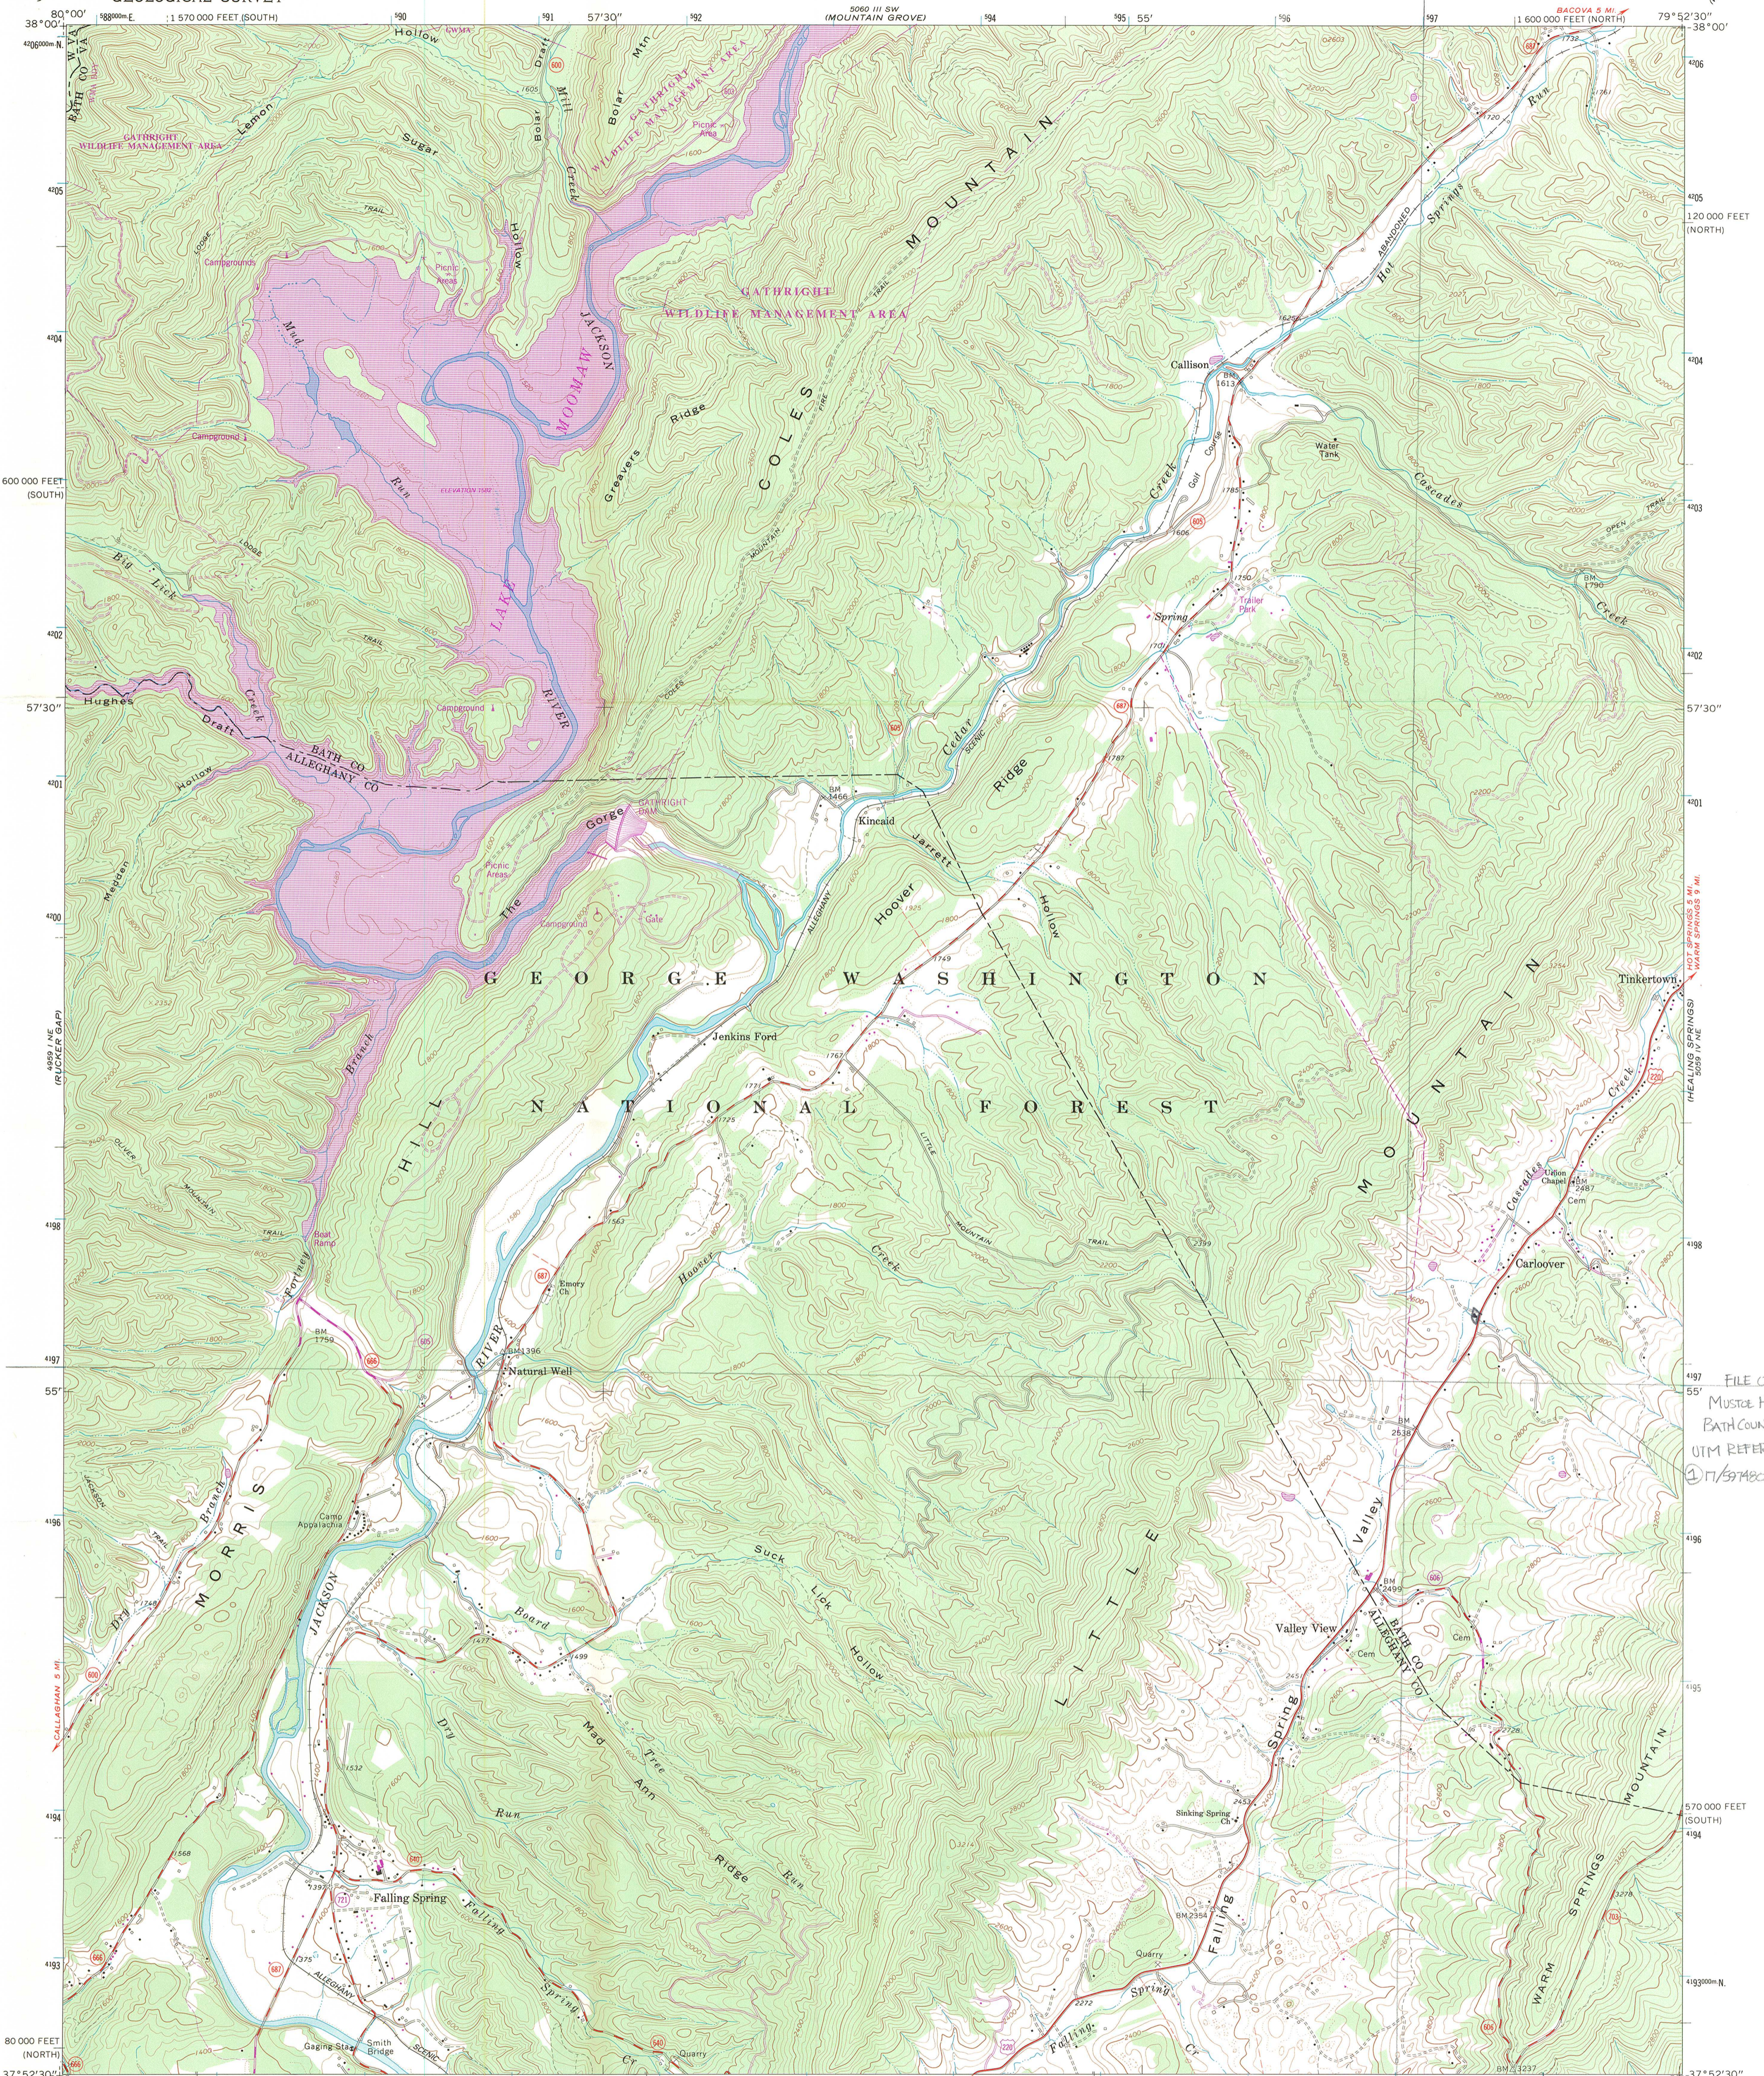

Mapped, edited, and published by the Geological Survey
Control by USGS, NOS/NOAA, and USCE
Topography by photogrammetric methods from aerial photographs
taken 1963. Field checked 1966
Polyconic projection. 10,000-foot grid ticks based on Virginia
coordinate system, north and south zones
1000-meter Universal Transverse Mercator grid ticks,
zone 17, shown in blue
1927 North American Datum
To place on the predicted North American Datum 1983
move the projection lines 9 meters south and
19 meters west as shown by dashed corner ticks
Fine red dashed lines indicate selected fence and field lines where
generally visible on aerial photographs. This information is unchecked
There may be private inholdings within the boundaries of
the National or State reservations shown on this map

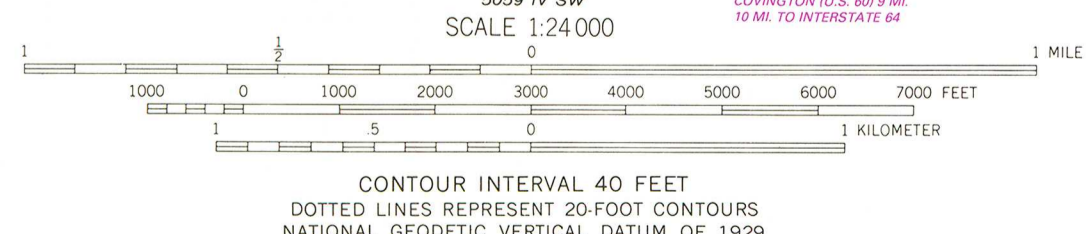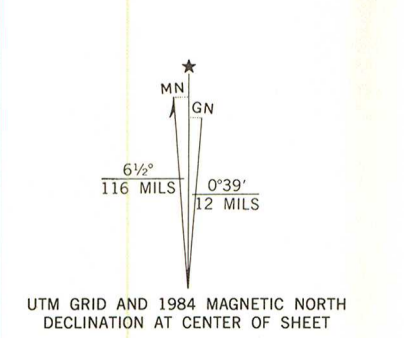

THIS MAP COMPLIES WITH NATIONAL MAP ACCURACY STANDARDS
FOR SALE BY U.S. GEOLOGICAL SURVEY
DENVER, COLORADO 80225, OR RESTON, VIRGINIA 22092
AND VIRGINIA DIVISION OF MINERAL RESOURCES, CHARLOTTESVILLE, VIRGINIA 22903
A FOLDER DESCRIBING TOPOGRAPHIC MAPS AND SYMBOLS IS AVAILABLE ON REQUEST



ROAD CLASSIFICATION

Heavy-duty	Light-duty
Medium-duty	Unimproved dirt
U.S. Route	State Route

FALLING SPRING, VA. - W. VA.
37079-H8-TF-024

1966
PHOTOREVISED 1984
DMA 5059 IV NW - SERIES V834

Revisions shown in purple and woodland compiled in cooperation with
Commonwealth of Virginia agencies from aerial photographs
taken 1982 and other sources. This information not field checked
Map edited 1984

FILE 03-16
JUSTICE HOUSE
BATH COUNTY VA
UTM REFERENCES
17N57480A197450

MAGNETIC 1992

RESIDUE
RENE R. DUFOUR
DEED BOOK 83 PAGE 166
TAX REF. 101-15

SIPHC

S54°43'21"E
138.75'

0.4 MILES TO
CARLOVER LANE

SIPHC

A=78.62' · R=9595.65'
S35°02'34"N 78.62'

N26°19'10"E
303.68'

VDOT MON.

1.070 ACRES

U.S. ROUTE 220

FILE 03-76
MUSTICE HOUSE
BATH COUNTY VA

A=281.01' · R=891.06'
S25°46'24"N 278.65'

SITE PLAN

CONTRIBUTING BUILDING

R=200.00'
N 79.77'

FOR ARCHITECTURAL DESCRIPTION

NOT TO SCALE